


MACHO PARA MÁQUINA - HSSE - HASTE PASSANTE


M - Rosca Métrica Grossa

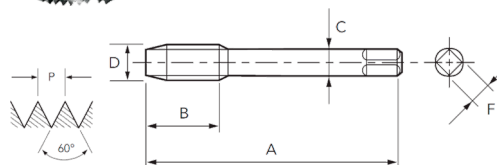

D (mm)	P (mm)	A (mm)	B POT	B SFT	Ø C (mm)	F (mm)	Ø Broca (mm)
M 3	0,50	56	11	5,0	3,5	2,7	2,5
M 4	0,70	63	13	7,0	2,8	2,1	3,3
M 5	0,80	70	16	8,0	3,5	2,7	4,2
M 6	1	80	19	10,0	4,5	3,4	5,0
M 8	1,25	90	22	13,0	6,0	4,9	6,8
M 10	1,50	100	24	15,0	7,0	5,5	8,5
M 12	1,75	110	29	15,0	9,0	7,0	10,3

MACHO PARA MÁQUINA - HSSE - HASTE PASSANTE

MF - Rosca Métrica Fina

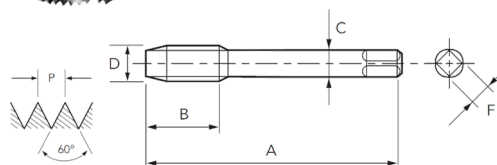

D (mm)	P (mm)	A (mm)	B POT	B SFT	Ø C (mm)	F (mm)	Ø Broca (mm)
M 3	0,35	56	9	9,0	2,2	2,1	2,7
M 4	0,50	63	10	10,0	2,8	2,1	3,5
M 5	0,50	70	12	12,0	3,5	2,7	4,5
M 6	0,75	80	14	14,0	4,5	3,4	5,3
M 8	0,75	80	19	19,0	6,0	4,9	7,2
M 8	1	90	22	22,0	6,0	4,9	7,0
M 10	1	90	20	20,0	7,0	5,5	9,0
M 10	1,25	100	24	24,0	7,0	5,5	8,8
M 12	1	100	22	22,0	9,0	7,0	11,0
M 12	1,25	100	22	22,0	9,0	7,0	10,8
M 12	1,50	100	22	22,0	9,0	7,0	10,5
M 14	1,25	100	22	22,0	11,0	9,0	12,8
M 14	1,50	100	22	22,0	11,0	9,0	12,5
M 16	1	100	22	22,0	12,0	9,0	15,0
M 16	1,50	100	22	22,0	12,0	9,0	14,5